


| SPECIFICATION | CONNECTION | BIPOLAR |
|--------------------------------------------------------------------|------------|-----------------------------------|
| VOTAGE(VOC) | | 2.80 |
| AMPS/PHASE | | 1.68 |
| RESISTANCE/PHASE(Ohms)@25°C | | 1.65±10% |
| INDUCTANCE/PHASE(mH)@1KHz | | 2.80±20% |
| HOLDING TORQUE w/o GEARBOX(Nm)[lb-in] | | 0.44[3.89] |
| GEAR RATIO | | 19 ³⁸ / ₁₈₇ |
| EFFICIENCY | | 81.00% |
| STEP ANGLE w/o GEARBOX(°) | | 1.80 |
| BACKLASH@NO-LOAD | | <=1° |
| MAX.PERMISSIBLE TORQUE(Nm) | | 3.00 |
| MOMENT PERMISSIBLE TORQUE(Nm) | | 5.00 |
| SHAFT MAXIMUM AXIAL LOAD(N) | | 50.00 |
| SHAFT MAXIMUM RADIAL LOAD(N) | | 100.00 |
| WEIGHT(Kg)[lb] | | 0.60[1.32] |
| TEMPERATURE RISE:MAX.80°C (MOTOR STANDSTILL;FOR 2PHASE ENERGIZED) | | |
| AMBIENT TEMPERATURE -10°C~50°C[14°F~122°F] | | |
| INSULATION CLASS B 130°C[266°F] | | |

| TYPE OF CONNECTION (EXTERN) | | MOTOR | |
|-----------------------------|---------|-------|---------|
| PIN NO | BIPOLAR | LEADS | WINDING |
| 1 | A — | BLK | A |
| 2 | A\ — | GRN | A\ |
| 3 | B — | RED | B |
| 4 | B\ — | BLU | B\ |

FULL STEP 2 PHASE-Ex. ,
WHEN FACING MOUNTING END (X)

| STEP | A | B | A\ | B\ | | |
|------|---|---|----|----|---|-----|
| 1 | + | + | - | - | ↓ | CCW |
| 2 | - | + | + | - | | ↑ |
| 3 | - | - | + | + | ↓ | CW |
| 4 | + | - | - | + | | ↑ |

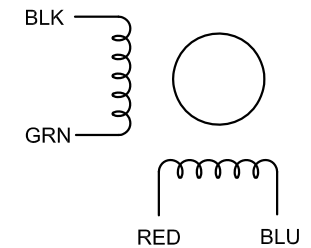

| | | | |
|-------|-----------|------|--|
| | APVD | | |
| | CHKD | | |
| 1:1 | DRN | | |
| SCALE | SIGNATURE | DATE | |

STEPPER MOTOR

17HS19-1684S-PG19